



Service Bulletin

Bulletin No.: 22-NA-087

Date: May, 2022

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC's P0201, P0202, P0203, P0204, P0205, P0206 and/or P0216 Set

Reference PIP5840 When Performing Repair

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2021	2022			LM2	
Chevrolet	Silverado 1500						
	Suburban						
	Tahoe						
GMC	Sierra 1500						
	Yukon Models						

Involved Region or Country	North America
Condition	<p>Some customers may comment that the MIL is illuminated. Some customers may also comment that the engine runs rough. Some technicians may find one or more of the following DTCs set:</p> <ul style="list-style-type: none"> • P0201 • P0202 • P0203 • P0204 • P0205 • P0206 • P0216
Cause	This condition may be caused by a broken terminal pin inside the #2 injector harness connector.
Correction	If the #2 injector has been identified as the concern, replace the #2 fuel injector and injector wiring harness.

Service Procedure

Refer to PIP5840 , *Fuel Injector Wiring Harness Replacement* in the Service Manual and *High Pressure Diesel Fuel Injector Replacement* in the Service Manual.

Parts Information

Causal Part	Description	Part Number	Qty
X	HARNESS, F/ INJR WRG	55513485	1
X	INJECTOR, HIGH PRESS DSL FUEL	55506244	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4022410	High Pressure Diesel Fuel Injector Replacement	Use the Published Labor Operations Time

Version	1
Modified	Released May 05, 2022

